


These Moore & Wright gauges are ideally suited for measuring bores, internal grooves and other difficult to reach internal dimensions.

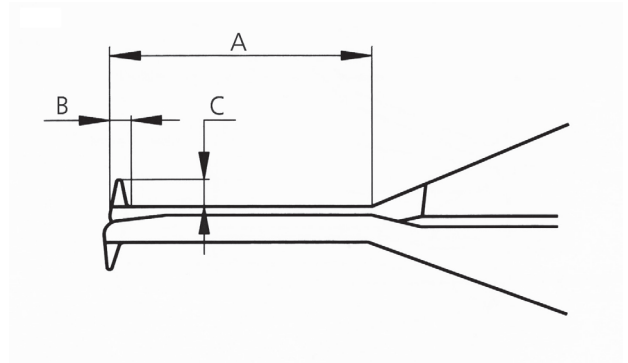

Features

- For measuring bores, internal grooves and other hard to reach inside dimensions
- Large LCD display
- Functions: mm/inch conversion, zero setting, tolerance setting, absolute or incremental modes, battery low indication
- Auto adjusting analogue display
- 0.005mm or 0.0002" resolution

Specification							
Code No	Range (mm)	Range (inch)	Accuracy (mm)	Dimn A (mm)	Dimn B (mm)	Dimn C (mm)	Contact Radius (mm)
MW432-01DC	5-15	0.2-0.6	±0.02	20.0	1.0	1.5	0.3
MW432-02DC	10-20	0.4-0.8	±0.02	25.0	25.0	3.0	0.3
MW432-03DC	20-30	0.8-1.2	±0.02	30.0	2.0	6.5	0.5
MW432-04DC	30-40	1.2-1.6	±0.02	30.0	2.5	9.0	0.5
MW432-05DC	40-50	1.6-2.0	±0.02	30.0	2.5	9.0	0.5